AIR GAUGE DISPLAYS

DATA OUTPUT


VIDEO




9408-QD100



9408-QA101

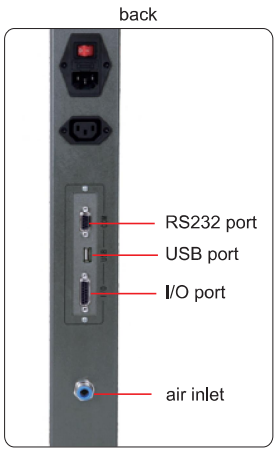

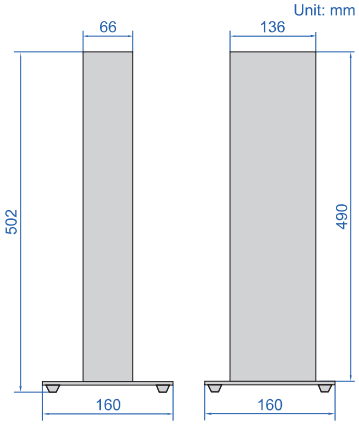

- Can store 10 measuring programs, and the programs can be switched quickly
- Data storage and query function

SPECIFICATION

Code		9408-QD100 (without beep and light alarm)		9408-QA101 (with beep and light alarm)
LED quantity		101 pcs		
LED color		red, orange, green		
LED height		254mm		
Range, resolution and accuracy		range (μm)	resolution(μm)	accuracy (μm)
			LED	display
		10	0.1	0.1	0.2
		20	0.2	0.1	0.4
		50	0.5	0.1	1
		100	1	0.2	3
Unit		mm, inch		
Air supply		dry and clean, 0.4~0.7MPa		
Data interface		RS232, USB		
Operation temperature	temperature	0~45°C		
	humidity	≤85%		
Power supply		AC185~265V, 50/60Hz		
Dimension (L×W×H)		160×160×490mm		
Weight		2.8kg		

STANDARD DELIVERY

Main unit	1 pc

OPTIONAL ACCESSORY

RS232 cable	9408-CB
Foot switch	9408-FS (must be installed in factory)
Data output cable (keyboard format)	7302-9408
Wireless transmitter (receiver is needed)	7315-9408
Air filter	9401-FILTER-A
Pressure regulating valve	9404-PRV



foot switch (**optional**)



RS232 cable (**optional**)



pressure regulating valve (**optional**)



air filter (**optional**)